

 Code:
 1011-2019

 Date:
 20.09.2021.

 Version:
 1.0

 Page:
 1 of 14

GNSS CALIBRATION REPORT TRANSFER OF CALIBRATION BH03-BH02

Prepared by: Sani Sarcevic (IMBIH)

Approved by: Osman Sibonjic (IMBIH)

Authorized by: BIPM

Project: Code: Date: Version: Transfer of calibration BH03-BH02, 2021. 1011-2019 20.09.2021. 1.0



Code:	1011-2019
Date:	20.09.2021.
Version:	1.0
Page:	2 of 14

Table of Contents

ACRONYMS AND ABBREVIATIONS	3
LIST OF TABLES AND FIGURES	4
SUMMARY	5
1 DESCRIPTION OF EQUIPMENT AND OPERATIONS	6
2 DATA USED AND RAW DATA PROCESSING	7
3 CALIBRATION RESULTS	8
4 UNCERTAINTY ESTIMATION	9
5 FINAL RESULTS	
ANNEX A – INFORMATION SHEET	11
ANNEX B PLOTS OF RAW DATA AND TDEV ANALYSIS	13
 PTB GNSS calibration report G1G2_1011_2019 BIPM guidelines for GNSS calibration, V3.0, 02/04/2015 	

[3] JCGM 100:2008 Evaluation of measurement data — Guide to the expression of uncertainty in measurement,



ACRONYMS AND ABBREVIATIONS

IMBIH PTB BIPM CGGTTS GNSS GPS IGS ESA ITRF MJD NMI NRCan PPP RINEX TDEV TIC UTC UTC UTC UTC(k) CAB DLY INT DI Y	Institute of metrology of Bosnia and Herzegovina Physikalisch-Technische Bundesanstalt Bureau International des Poids et Mesures. Generic GNSS Time Transfer Standard. Global Navigation Satellite System Global Positioning System. International GNSS Service. European Space Agency International Terrestrial Reference Frame. Modified Julian Date. National Metrology Institute. Natural Resources Canada. Precise Point Positioning. Receiver Independent Exchange Format. Time Deviation. Is a measure of time stability based on the modified Allan variance. Time Interval Counter Coordinated Universal Time. Version of UTC realized at each of the contributing NMIs Delay inside the antenna cable, including both end connectors. Delay of the GNSS signal inside the antenna and the receiver
CAB DLY	Delay inside the antenna cable, including both end connectors.
INT DLY	Delay of the GNSS signal inside the antenna and the receiver
REF DLY	Time offset between the receiver internal clock and the local clock at the station



LIST OF TABLES AND FIGURES

- Table 1:
 Summary information on the calibration trip
- Table 2:Summary information on the raw calibration results
- Table 3:
 REFDLY and CABDLY values from information sheets
- Table 4: Steps to calculate \triangle INTDLY for BH03-BH02
- Table 5:Uncertainty contributions
- Table 6: Final results
- Table 7 Information sheet
- Figure 1: Diagram of experiment setup
- Figure 2: Antenna roof positions
- Figure 3: Plots of RAW data and TDEV analysis



 Code:
 1011-2019

 Date:
 20.09.2021.

 Version:
 1.0

 Page:
 5 of 14

SUMMARY

As part of G1G2 calibration trips, IMBIH receiver BH02 was calibrated in 2019 respect to PTB reference PT09 and reported in Cal_Id=1011-2019 [1]. In 2021. IMBIH procured new receiver BH03.

This report documents transfer of calibration from reference receiver BH02 to BH03. The results will be reported using Cal_Id 1011-2019 and will provide internal delays for BH03 receiver for P1, P2, and C1 GPS signals.

The calibration is declared to the BIPM on August 30 2021, and the measurements are done from MJD 59458 to 59465 (September 01 – September 08 2021). Data analysis and report are finished in September 2021.



1 DESCRIPTION OF EQUIPMENT AND OPERATIONS

IMBIH receiver BH02 (GTR51) participated in G1G2 trip Cal_Id=1011-2019, and was calibrated respect to PTB reference. In 2021. IMBIH procured additional GNSS receiver: Mesit GTR55.

This is a transfer of calibration BH02 to BH03. BH02 (GTR51) is a reference receiver (R) and BH03 is a visited receiver (V) – DUT. There is no traveling system (T) involved. A complete information related with the receivers set-up and the signal distribution system have been provided in Annex-A.

Information about the calibration campaign are summarized in Table 1.

NMI	Receiver status	Dates of measurement	Receiver type	BIPM code
IMBH	Reference	-	GTR51	BH02
IMBH	Visited	59458 - 59465	GTR55	BH03

Table 1: Summary information on the calibration trip



2 DATA USED AND RAW DATA PROCESSING

The current campaign has been carried out following as much as possible the BIPM guidelines for GNSS calibrations [2]. The results will be reported using Cal_ld 1011-2019, and they will provide the visited receiver's internal delays for GPS C1, P1 and P2 code signals on the two carrier frequencies L1 and L2.

The calibration has been performed based on observations provided in the RINEX observation files, using all in view GPS satellites, at 30 seconds time intervals. We have also used the GNSS broadcast ephemeris files provided by ESA. The coordinates of the antenna phase centre have been computed from RINEX files by using the NRCan PPP software.

RAW data processing is done using dclrinex software from the BIPM. [1]. Annex 2 of the this report shows pseudorange values from RINEX files and a plot of the statistical analysis (TDEV) for V-R pair and for each code.

The median value, noted RAWDIF, and its uncertainty from the statistical analysis for BH03-BH02 and each code are shown in Table 2.

Code	RAW DIFF (ns)	uA (ns)
P1	-10.078	0.1
P2	-12.145	0.1
C1	-9.440	0.1

Table 2: Summary information on the raw calibration results



 Code:
 1011-2019

 Date:
 20.09.2021.

 Version:
 1.0

 Page:
 8 of 14

3 CALIBRATION RESULTS

Since the current campaign is transfer of calibration, we don't utilize traveling receiver (T), BH02 serves as reference (R), and BH03 is a visited one (V).

Receiver delays are defined as:

CABDLY is the delay of the cable from the antenna to the input connector of the receiver, REFDLY represents the offset between the UTC reference point in the laboratory and the reference point of the receiver,

INTDLY is the internal signal delay (antenna + receiver internal).

In addition: SYSDLY = INTDLY + CABDLY TOTDLY = SYSDLY - REFDLY

Results of Dclrinex computation for each code are noted as RAW DIFF and are equal to Δ TOTDLY. The quantity to be determined by the relative calibration is INTDLY(V-R) value for each code.

For the pair of systems V-R we note: Δ SYSDLY(Code) = RAWDIF(Code) + REFDLY(V) – REFDLY(R)

where RAWDIF(Code) is result from dclrinex computation, shown in Table 2, and REFDLY values are taken from the "information sheets" - Annex A of this report.

 $INTDLY(Code) = \Delta SYSDLY(Code) - CABDLY(V) + CABDLY(R)$

where the values CABDLY are taken from the "information sheets".

Table 3 shows REFDLY and CABDLY values for both receivers, while Table 4 shows steps to calculate INTDLY for each code.

Receiver	REFDLY (ns)	CABDLY (ns)
BH03	10.50	137.30
BH02	7.60	128.20

Table 3: REFDLY and CABDLY values from information sheets

Code	RAW DIF (ns)	ΔSYSDLY (ns)	INTDLY (ns)
P1	-10.08	-7.19	13.91
P2	-12.16	-9.25	11.46
C1	-9.44	-6.54	14.56

Table 4: Steps to calculate Δ INTDLY for BH03-BH02



 Code:
 1011-2019

 Date:
 20.09.2021.

 Version:
 1.0

 Page:
 9 of 14

4 UNCERTAINTY ESTIMATION

Uncertainty estimation follows the guidelines described in [3]. The overall uncertainty of the INT DLY values is given by:

 $u_{CAL} = \sqrt{uA^2 + uB^2}$

where uA represent statistical uncertainty from TDEV (Table 2) and uB represent systematic uncertainty given by

$$u_B = \sqrt{\sum_n u(b, n)^2}$$

All values are considered to be 1-sigma. Values P3 are computed as P1 + 1.545*(P1-P2). The contributions to the total uncertainty are listed in Table 5.

Uncertainty	P1 (ns)	P2 (ns)	P1-P2 (ns)	P3 (ns)	Component description
uA	0.1	0.1	0.1	0.2	RAWDIF TDEV at 1000s
uB1	0.1	0.1	0.1	0.2	Position error of reference
uB2	0.1	0.1	0.1	0.2	Position error of visited
uB3	0.2	0.2	0.0	0.2	Multipath at reference
uB4	0.2	0.2	0.0	0.2	Multipath at visited
uB5	0.3	0.3	0.0	0.3	REFDLY(R)
uB6	0.3	0.3	0.0	0.3	REFDLY(V)
uB9	0.1	0.1	0.0	0.1	TIC nonlinearities
uB	0.5	0.5	0.2	0.6	uB Total
uCAL	0.5	0.5	0.2	0.7	Overall uncertainty



 Code:
 1011-2019

 Date:
 20.09.2021.

 Version:
 1.0

 Page:
 10 of 14

5 FINAL RESULTS

INT DLY of the device under test is determined in such a way that the common-clock differences obtained between the device under test and the reference are zero on average. The final results for receiver V are calculated as:

 $INTDLY(V)(Code) = INTDLY(R)(Code) + \Delta INTDLY(V-R)(Code).$

Table 6 shows new INTDLY values for each code to be entered in BH03.

Reference system	Cal_ld	Date		INTDLY P1 (ns)	INTDLY P2 (ns)	INTDLY C1 (ns)
BH02	1011-2019	2019.09		30.20	29.80	30.20
Visited system	Cal_ld		U _{CAL} (P3) (ns)	INTDLY P1 (ns)	INTDLY P2 (ns)	INTDLY C1 (ns)
BH03	1011-2019	2021.09	0.7	13.91	11.46	14.56

Table 6: Final results




ANNEX A – INFORMATION SHEET


	Table 7 Infor	mation sheet		
Laboratory:	IMBH			
Date and hour of the				
beginning of	1 01.09.2021. 00:00:00			
measurements:				
Date and hour of the	2 08.09.2021.23:5	0.50		
end of measurements:	2 00.05.2021, 25.5			
	Information	on the system		
	Local:	Reference:		
4-character BIPM code	BH03	BH02		
• Receiver maker and type:	Mesit, GTR 55	Mesit, GTR 51		
Receiver serial number:	2010004	1808032		
1 PPS trigger level /V:	1.0	1.0		
• Antenna cable maker and	Andrew Heliax FSJ1-50A -	Belden, 50 Ω , low loss, H155 PVC		
type:	1/4"			
Phase stabilised cable (Y/N):	Ν	Ν		
Length outside the building /m:	Approx. 10	Approx. 10		
• Antenna maker and type:	Novatel NOV850	Novatel NOV850		
Antenna serial number:	NMLK20250004R	NMLK18070098S		
Temperature (if	44 ± 1	45 ± 1		
stabilised) /°C				
		delays /ns		
	Local:	Reference:		
• Delay from local UTC to receiver 1 PPS-in:	10.50	7.60		
Delay from 1 PPS-in to				
internal				
Reference (if different):				
Antenna cable delay:	137.30	128.20		
Splitter delay (if any):				
Additional cable delay (if				
any):				
	Data used for the gene	ration of CGGTTS files		
• INT DLY (GPS) /ns:	46.74(P1),51.37(P2),46.59(C1),50.90(C2)	30.20(P1),29.80(P2),30.20(0 (C2)	21),7.80	
• INT DLY (Galileo) /ns:				
• INT DLY (GLONASS) /ns:				
• CAB DLY /ns:	137.30	128.20		
• REF DLY /ns:	10.50	7.60		
• Coordinates reference frame:	ITRF	WGS-84		



Code:	1011-2019
Date:	20.09.2021.
Version:	1.0
Page:	12 of 14

Latitude or X /m:	+4371185.7	4371185.0	
Longitude or Y /m:	+1454855.7	1454855.8	
Height or Z /m:	+4397062.3	4397062.7	
General information			
• Rise time of the local UTC	1.47 ns	1.47 ns	
pulse:			
• Is the laboratory air conditioned:	Yes	Yes	
Set temperature value and uncertainty:	23 ± 1 °C	23 ± 1 °C	
Set humidity value and uncertainty:	45 ± 10 % RH	45 ± 10 % RH	



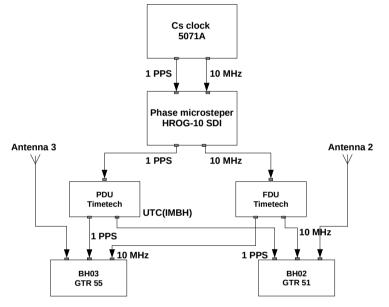



Code:	1011-2019
Date:	20.09.2021.
Version:	1.0
Page:	13 of 14

Figure 2: Antenna roof positions






Code:	1011-2019
Date:	20.09.2021.
Version:	1.0
Page:	14 of 14

ANNEX B PLOTS OF RAW DATA AND TDEV ANALYSIS

Figure 3: Plots of RAW data and TDEV analysis

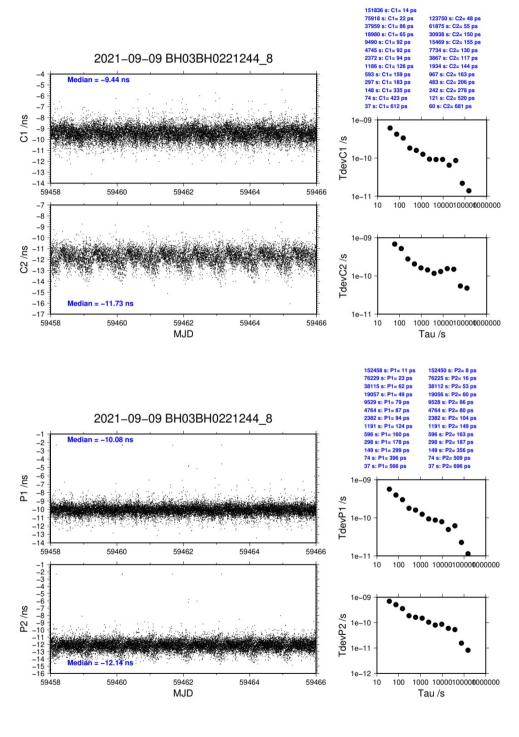

END OF DOCUMENT

Institute of Metrology of Bosnia and Herzegovina, Sarajevo, September 2021